

 
If these measures also fail to effect a remedy, take off the cylinder heads and check for blow-by past the valves (fuel test in exhaust and inlet tracts).

If necessary, regrind the valves or machine the valve seats.

Warning: to avoid discolored exhaust pipes on new motorcycles during engine adjustment work, the engine must not be run with the motorcycle at a standstill for more than 10 minutes. Use a separate cooling fan.

Yours truly,

BMW OF NORTH AMERICA, INC.

A handwritten signature in dark ink, appearing to read 'H. Neas', is written over the typed name.

H. Neas
National Service Manager

HN/cs