

Service-Information Motorcycle



BMW NA
Service Department

Group: 61
General
Electrics

April, 1988
61 016 88
(2301)

For USA Only

Accessory Socket Fuse - R100RS and R100RT Models

Problem: No electrical current (12 volts) at the accessory socket (BMW Battery Charger does not charge through the socket).

The fuse holder on **some** models was assembled incorrectly. The small spring which tensions the lug into the fuse was installed on the wrong side of the wire lug. This restricts the flow of current through the fuse holder assembly by making a poor contact to the fuse.



Install spring here

Remedy: Remove the fuse spring from the plastic holder. Pull on the wire end lug slightly, exposing 1 inch of the wire. Wind the small spring onto the wire between the wire end and plastic holder. Wind the spring in a manner similar to winding a key onto a key ring, or use a soldering iron to unsolder the lug. Position the spring over the wire and solder the lug on again.

Warranty: Labor is reimbursable under the BMW Limited Motorcycle Warranty of Three (3) Years/Unlimited Miles.

Warranty Claim: Submit a normal warranty claim using:

Defect Code:	6100007700
Flat Rate Code:	0000000
Flat Rates:	WT= 1 FR= (5 min.)
Comments:	Fuse holder assembled incorrectly

Very truly yours,

BMW OF NORTH AMERICA, INC.

Frank Stevens
National Service Manager

Richard Dampf
National Technical Manager

je1/694.3