

Service-Information Motorcycle



BMW NA
Service Department

Group: 46

September, 1988

Frame

46 020 88
(2325)

For USA Only

Fairing/Fuel Tank Chafing - R80RT and R100RT

Problem: The fairing pocket might rub against the fuel tank on "RT" models.

Remedy: Loosen the bolts that hold the bottom of the upper fairing section (bolts are accessible from inside the fairing pocket). Push the fairing outward and retighten so that the bolts are at the outer end of the slots.

A rubber support - **part no. 52 53 1 230 319** - (as installed under the dual seat) can be installed in the top corner of the inside pocket at the point of contact. Remove the fuel tank and drill a 7mm hole at the contact point and install the rubber support.

Note: This modification will be adopted on all production motorcycles.

The slot in the fairing bracket will be replaced by a hole.

Very truly yours,

BMW OF NORTH AMERICA, INC.

A handwritten signature in cursive script, appearing to read 'Frank Stevens'.

Frank Stevens
National Service Manager

A handwritten signature in cursive script, appearing to read 'Richard Dampf'.

Richard Dampf
National Technical Manager