


Service-Information Motorcycle



©BMW of N.A. Service Department	Group: 13 Fuel Supply & Adjustment	August 1990 13 020 90 (2414)	For USA Only
------------------------------------	--	------------------------------------	--------------

Carburetor Vibration - 1988 R100

- Complaint:** Presence of fuel stains on the outside of the carburetor and float bowl. This could occur when engine is running at certain higher rpm's.
- Problem:** The carburetor can vibrate at certain speeds (usually high-speed), causing an increase in the fuel level in the float bowl.
- Remedy:** First, ensure that float bowl gasket is in good condition, that no contaminants are present in float bowl, and that fuel level is to specification. If the items mentioned above are all correct, then install carburetor mounting rubber tubes #13 72 1 254 654 in place of the stock tubes #13 72 1 338 360. These tubes have a different rubber density which will reduce carburetor vibration.

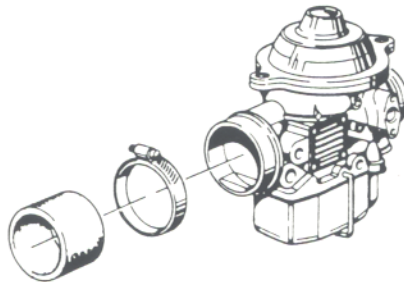

Warranty Status: Parts and Labor are reimbursable under the provisions of BMW Limited New Motorcycle Warranty of Three (3) Years/ Unlimited mileage, using a normal Warranty Claim Form:

Defect Code: 13 11 02 48 00
 Flat Rate Code: 13 72 261
 Flat Rate Units: 4 (20 minutes)

Very truly yours,

BMW of North America, Inc.

Frank Stevens
 National Service Manager
 Motorcycle Group
 FS: jel/337.18

Richard Dampf
 National Technical Manager

Please initial and route to the following before filing

Service	Parts	Sales	Warranty	Technicians	

