Service-Information Motorcycle



Group: Group 33

January 1992

BMW NA

Service Department

Rear Wheel

33 017 92 (2506) For USA Only

Rear Shock Adjustment Knob Numbering - R100GS 1991 Models

Complaint:

The white numbers on the rear shock adjusting knob

have a tendency to come off.

Remedy:

Future adjusting knobs will have raised numbers.

Replace the adjusting knob with:

Part No. 33 53 2 314 139

Replacement
Instructions:


- Turn the knob to the maximum

(position

10)

 Using a center punch, put a mark on the plastic nut which is below the knob

- Pry the knob off gently, using a screwdriver
- Using a plastic hammer, drive the new adjusting knob on with the Figure 10 aligned with your center punch mark:

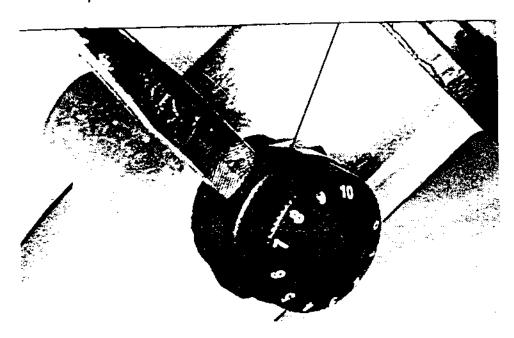

Please initial and route to the following before filing				
Service	Parts	Sales	Warranty	Technicians
			<u> </u>	

Warranty Status:

Parts and Labor are reimbursable under the provisions of

the BMW Limited Motorcycle Warranty of Three (3)

Years/Unlimited Miles, using a normal Warranty Claim Form.

Use Defect Code:

33 53 00 77 00

Use Flat Rate Code: 3399000

Use Flat Rate Units: 1

Very truly yours,

BMW of North America, Inc.

Frank Stevens National Service Manager

Motorcycle Group

FS:je1/103.3

Richard Dampf

National Technical Manager