

Service-Information Motorcycle



©BMW of N.A. Service Department	Group: 61 General Electrics	August, 1992 61 027 92 (2548)	For USA Only
------------------------------------	--------------------------------------	-------------------------------------	--------------

Additional Ground Between Engine and Frame - R100R Models


Problem: Grounding between the engine and frame is not always reliable on silver-painted frames. This may lead to ignition misfiring or insufficient alternator output.

Production

Line Change: Starting with VIN 0280227, a wire has been added from the starter motor cover to the ignition control unit mounting bracket.

Remedy: Install a ground wire to all affected R100R models with a VIN prior to 0280227.

The ground wire is secured to the left starter motor cover screw and the ignition control unit mounting bracket.

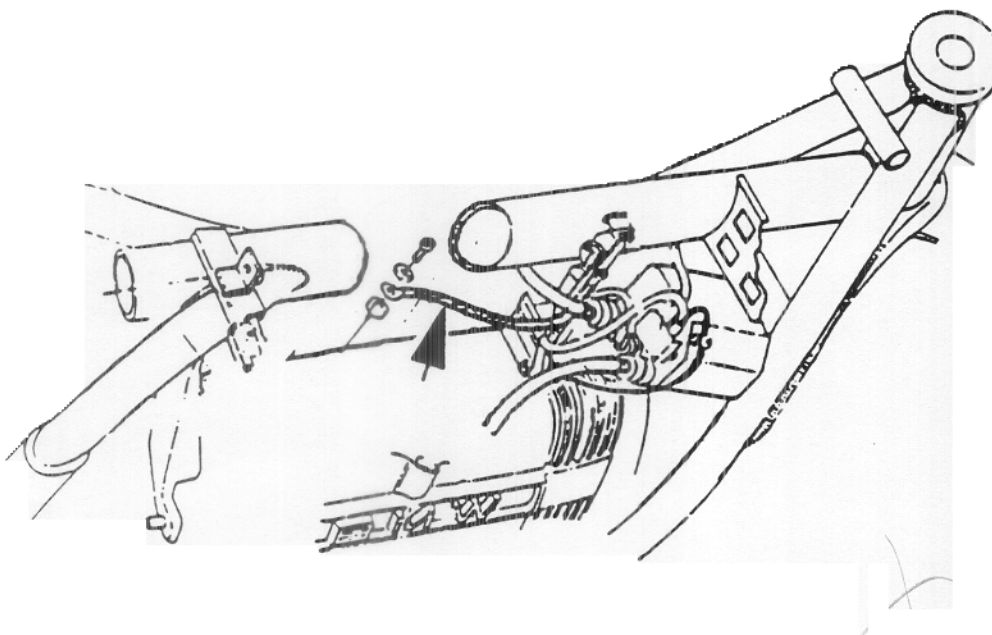

Please initial and route to the following before filing				
Service	Parts	Sales	Warranty	Technicians

Parts: 1 Ground Wire 61 12 1 244 787
1 Star Washer 07 11 9 936 133
1 Machine Screw 07 11 9 920 003
1 Bushing 61 13 1 354 359

Warranty: Labor and parts are reimbursable under the provisions of the BMW limited motorcycle warranty, using a normal warranty claim form.


Defect Code Number: 61 11 00 77 00

Flat Rate Code: 61 99 000


Flat Rate: 3 FR = (15 min.)

Very truly yours

BMW of North America, Inc.



Frank Stevens
National Service Manager
Motorcycle Group

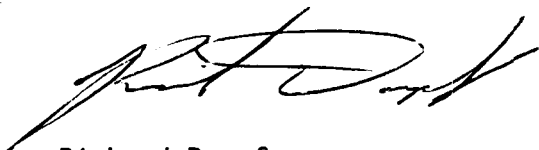

Richard Dampf
National Technical Manager