Service-Information Motorcycle

Group: 3

January 1992

QO M PE

BMW NA

Service Department

Equipment Advice

XVIII/92 (2509)

For USA Only

BMW Brake Bleeder Valves

Information:

The first production run of BMW Brake Bleeders were

produced with faulty air valves.

Cause:

The valve was manufactured with a burr or scratch on the valve seat which allowed air to pass even though the valve was shut off. This made bleeding the system

difficult.

Remedy:

Replace the valve with a new valve which looks

identical. The new improved valve will have an identification mark of red paint in the center of the

knurled knob.

Caution:


Use Teflon tape to seal the threads. Do not overtighten

the valves.

Note:

All dealers who purchased BMW Brake Bleeders will be sent two (2) replacements. Although there is no problem with the fluid valve, we want both valves replaced.

Replacement is self-explanatory. However, make certain the system's pressure has been bled prior to valve

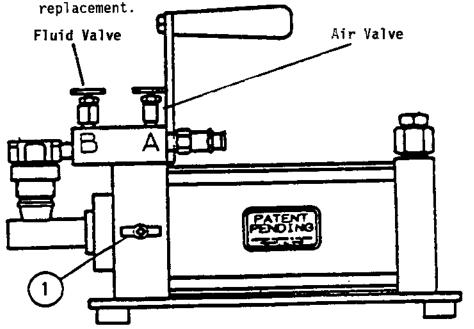

Please initial and route to the following before filing					
Service	Parts	Sales	Warranty	Technicians	
				-	

BMW Brake Bleeders

in Parts Inventory: Enclosed in each bleeder box will be a "Special Action" envelope with two (2) valves and a copy of

this Service Information bulletin.

We regret any inconvenience this has caused and certainly appreciate your assistance.

Very truly yours,

BMW of North America, Inc.

Frank Stevens National Service Manger

Motorcycle Group

FS:je1/107.3

Richard Dampf

National Technical Manager