



Service-Information

Cust.Serv.-Techn.Dept. VKT er-lü/wi/fm	2-Cylinder Motorcycles Group: Engine	Munich, 18 June 1964 Nr. 3/64 (211) en.
---	---	--

Re: Disc Springs for Clutch with increased Application-Pressure

Dear Sirs,

Please note that we have introduced reinforced clutch disc springs in order to avoid an occasional slipping of the clutch on the models R 69 S and R 60.

Commencing with frame Nr.

658 624 (R 69 S)

626 401 (R 60)

springs marked with a red plus-sign - Part Nr. 00 70 182 - (Application Pressure 366-397 lbs.) are installed as standard equipment.

Commencing with frame Nr.

636 591 (R 50)

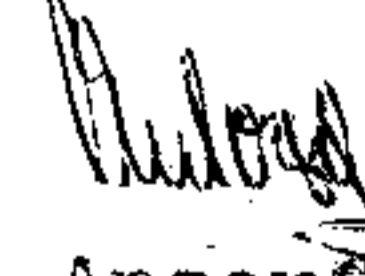
and for replacement on R 50 S

springs marked with a red minus-sign - Part Nr. 00 70 183 - (Application Pressure 330-364 lbs.) will be used.

The disc springs have undergone modification only as far as the material is concerned, no change was made in the dimension and clearances.

With friendly greetings,
BAYERISCHE MOTOREN WERKE
Aktiengesellschaft

i.V. 
Ortman

i.A. 
Anso

Kennntnis genommen	Betriebsleitung	Werkstatt	KD-Annahme	Gewährleistungs- Sachbearbeiter	E-Teildienst	Ablage	Betriebsleitung Werkstatt
-----------------------	-----------------	-----------	------------	------------------------------------	--------------	--------	------------------------------