

Service-Information Motorcycle



BMW NA
Service Department

Group: 16

July 1987

Fuel Tank
And Lines

16 015 87
(2244)

For USA Only

Fuel Cap Dust Lip Chafing Fuel Tank Surface - Boxer Models

Information: To prevent fuel tank's painted surface from being rubbed or chafed by the Dust Seal (Fig. 1), an O-Ring 44 x 4 mm (Part No. 11 42 1 337 098) can be fitted between the sealing surfaces as shown in Fig. 2.

The O-Ring will restrict compression of the fuel cap seal, raising the overall cap height when tightened, thereby preventing the Dust Seal from rubbing against the painted surface.

Very truly yours,

BMW OF NORTH AMERICA, INC.

Richard Dampf
National Technical Manager
Motorcycle Group
RD:jel/11

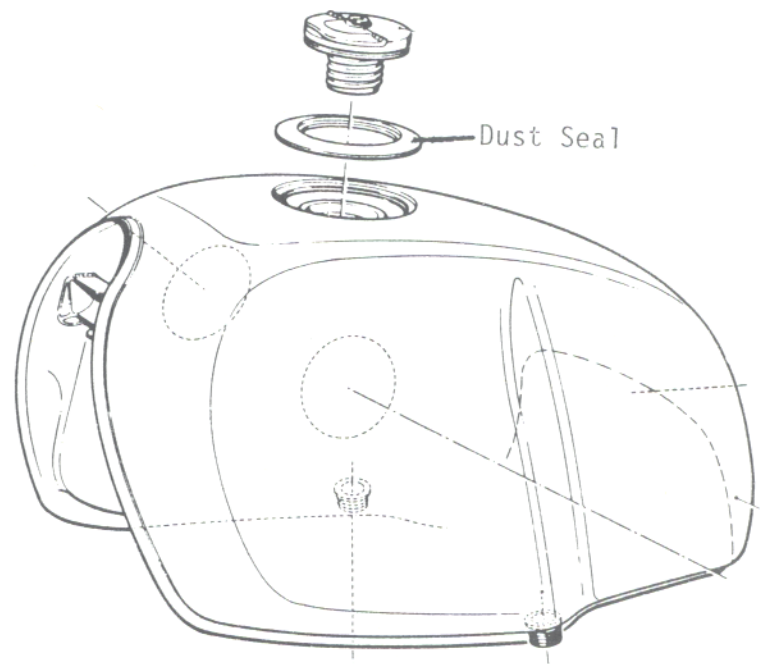


Fig. 1

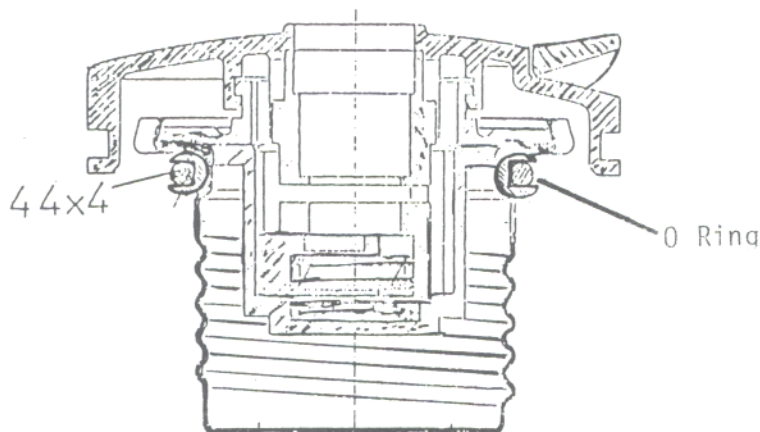


Fig. 2